

## Manuden

According to Dr Thresh's report of 1905, p52, the village was very fairly supplied by wells 15 to 25ft deep. Some cottage at Upend had to go half a mile to the farm for water.

**Pump/Well No.** MANU01



**Location:** Public Pump at front of cottages 19 Mallows Green Road, Mallows Green, Uttlesford, Essex, CM23 1DG  
**NGR:** Easting, Northing: 549033m, 236544m  
**Photographer:** S Thomas  
**Date Photographed:** 2009  
**Private or Communal:** Communal Village pump  
**Scheduled Monument:** No  
**Individually Listed Structure:** No – but the building is listed, so the pump is protected as part of the building, no mention of the pump in description)  
**Grade of Listing:** II  
**Date Listed:** 22/02/1980  
**LBS Number:** 408619  
**Listing Text:** “Range of early C19 clay lump cottages”  
**Well Series Record:** House opposite The Vicarage, Mallow Green Road, Made by G Ingold in 1887, water level at 18ft, slow spring, bored to 138ft through gravel and clay to chalk.  
**Well or borehole description:** Borehole  
**Water-raising mechanism:** C19 lift pump  
**Significant features:** **Description:** C19 cast iron lift pump in typical position in front of cottage  
**Lower Body:** banded  
**Upper Body:** moulded  
**Spout:** Located on upper body banded with plain bucket hook  
**Cap:** Large ball finial  
**Handle:** Located on the side with loop handle  
**Markers mark:** No mark by erected by H G Featherby in 1901  
**Working Order/Infilled/capped:** Not in working order

Manuden: The following pumps are recorded in Whitaker, W & Thresh, J (1916) Memoirs of the Geological Society England and Wales. The Water Supply of Essex from underground sources, Great Britain, Jas Truscott & Son

These Wells and pumps are still to be confirmed to the Author, they come from records made in 1916, so it might be that they no longer exist. Many though are on private property and the Author would welcome confirmation of their existence and to record them.

MANU02: Mr Burls grocery Stores, Manuden

Well sunk by H G Featherby in October 1900, water at 16ft, shaft down 24ft through gravel and loam.

MANU03: Mallows Green Public Village Pump, CM23 1BS

Recorded with Well sunk in 1901 by H G Featherby of Bishops Stortford. 155ft deep through clay, sand then chalk. Shaft is 4.3ft diameter to 40ft down, then 3.6ft to 50ft, the 4.3ft again to 105ft, the rest to 155ft is 4in borehole.

MANU04: Little Croft (formerly Parsonage farm), Manuden CM23 1BP

Old Well of unknown date, altered (presumably lowered) in 1925 by Well sinkers: Duke and Ockenden ltd of Little Hampton.

MANU05: Battles Hall (formerly Battles Farm), Maggot's End, Manuden CM23 1BJ

Well date unknown, noted with top sealed but not in-filled in 1965 records)

MANU06: 5 Catherine Buildings, Manuden

Old Well of unknown date –filled-in as noted in 1965 records

## Margaret Roding

According to Dr Thresh's report of 1901, 10 shallow wells supplied 60 houses.


**Pump/Well No.** MARGROD01



**Location:** Pump on side of Stable block at Brick House Farm, Ongar Road, Margaret Roding, Dunmow, Uttlesford, Essex, CM6 1QR  
**NGR:** Easting: 560559m, 211223m  
**Photographer:** S Thomas  
**Date Photographed:** 2009  
**Private or Communal:** Private pump for horses  
**Scheduled Monument:** No  
**Individually Listed Structure:** The building is listed, so the pump is protect by the house listing, no mention of the pump in the listing text.  
**Grade of Listing:** II  
**Date Listed:** 17/10/1983  
**LBS Number:** 352792  
**Listing Text:** "C17 house with C19 stable block"  
**Well Series Record?** -  
**Well or borehole description:** Brick rainwater Well/tank next to the west side door of the house  
**Water-raising mechanism:** C18th long case lift pump  
**Significant features:** **Description:** Longcase lift pump with a very decorative lead cistern of shells. The rod and wooden clack valve are missing; this pump is currently undergoing conservation in an effort to bring it back to working order  
**Casing:** Elm wood casing, currently with doors missing  
**Lower Body:** lead stand pipe  
**Upper Body:** lead cistern with shells, missing wooden bucket valve  
**Spout:** lead spout, with wrought iron support  
**Handle:** wrought iron handle with ball end, rod attachment is missing  
**Working Order/Infilled/capped:** Not in working order, although currently undergoing conservation

**Pump/Well No.**

MARGROD02

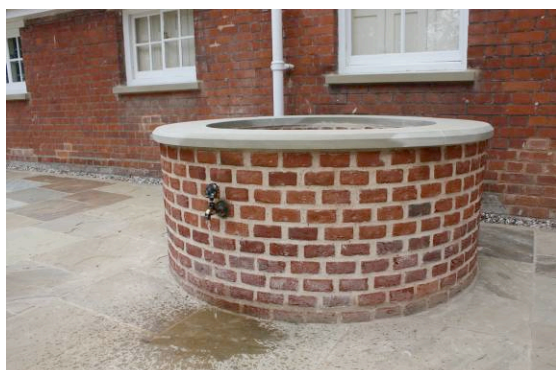

**Location:** C17 Well at rear, east side of Brick House Farm, Ongar Road, Margaret Roding, Dunmow, Uttlesford, Essex, CM6 1QR  
**NGR:** Easting: 560571m, 211239m  
**Photographer:** S Thomas  
**Private or communal:** Private domestic well  
**Date Photographed:** 2009  
**Scheduled Monument:** No  
**Listed Structure:** Not individually, but the house is listed and therefore the well is protected by the house listing.  
**Grade of Listing:** II  
**Date Listed:** 17/10/1983  
**LBS Number:** 352792  
**Listing Text:** "C17 house with C19/early C20 stable block  
**Well Series Record?** -  
**Well or borehole description:** C17 single red brick well, dry laid, 4ft diameter, approx 12ft deep  
**Water-raising mechanism:** electric pump  
**Significant features:** Typical Essex well construction of single brick, dry laid. It now has a new well head and electric pump with tap to front of the well head and is used to water the garden. In the house in the rear laundry building there is a wooden board which took a pump, this is connected via a lead pipe to the well. The internal pump is no longer in position.  
**Well Shaft:** circa C17 4 ft diameter brick well, dry laid, single brick shaft stretchers.  
**Depth/diameter:** 4ft diameter 12ft deep  
**Well head:** At surface new (2009) double brick header well head with Bulmer bricks to match and clipsham stone top.

**Working Order/Infilled/Disused:** In working order